

STATE OF ALASKA  
DEPARTMENT OF NATURAL RESOURCES

LAND SURVEY MONUMENT RECORD

1.  LAND CORNER RESTORATION  
 LAND CORNER REESTABLISHMENT  
 LAND CORNER ESTABLISHMENT (COMPLETE ITEM NO. 5 )  
 OTHER: EXPLAIN \_\_\_\_\_

2. DESCRIPTION OF CORNER EVIDENCE FOUND OR A CONCISE STATEMENT OF THE METHOD USED TO REESTABLISH THE CORNER:


Found original BLM 3 1/2" brass cap on 2 1/2" dia. I.P. extending 15' above ground and leaning to the southeast. Found rotting stump of 10" spruce with the scribe marks " 3 BT " clearly visible on the side facing the monument at N. 62°E, 15.7'. BLM record is "A spruce, 10 ins. diam., bears N. 60°15'E., 24 lks. (15.8') disc., mkd. 1/4 S 3 BT."

3. DESCRIPTION OF MONUMENT AND ACCESSORIES ESTABLISHED TO PERPETUATE THE LOCATION OF THE MONUMENT,

Plumbed monument on its base and reset flush with ground and placed a 2" x 4" red and white witness post 1' south.

Two new bearing trees were balzed, flagged with orange plastic ribbon and a 16d nail was driven 3' above the ground in the right side of the tree facing from the monument (see sketch below)

4. SKETCH SHOWING THE RELATIVE LOCATION OF MONUMENT AND REFERENCE POINTS. (USE ADDITIONAL SHEETS IF NECESSARY)

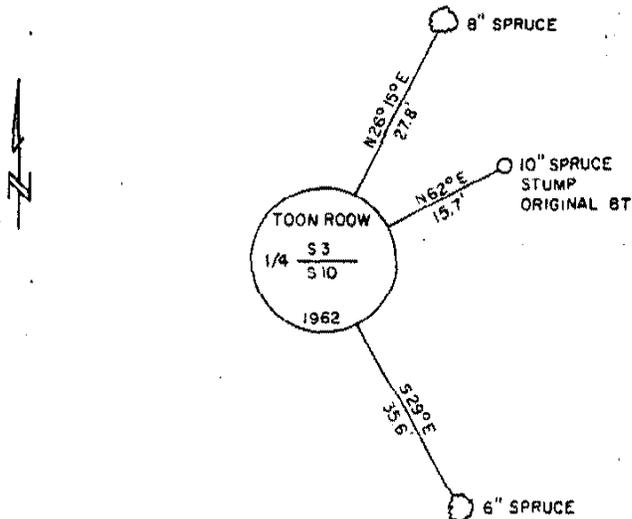


SAMPLE

5. PREPARE A SKETCH SHOWING THE MONUMENTS USED AND MEASUREMENTS MADE TO DETERMINE THE POSITION OF THE MONUMENT BEING ESTABLISHED:

DATE OF FIELD WORK July 17, 1986

SURVEYOR'S CERTIFICATE

6. I John Q. Surveyor,  
 REGISTRATION NO. 0000-S DO HEREBY CERTIFY  
 THAT I WAS IN RESPONSIBLE CHARGE OF THE  
 SURVEYING WORK DESCRIBED IN THIS RECORD AND  
 THAT TO THE BEST OF MY KNOWLEDGE THE INFOR-  
 MATION PRESENTED HEREIN IS TRUE AND CORRECT.

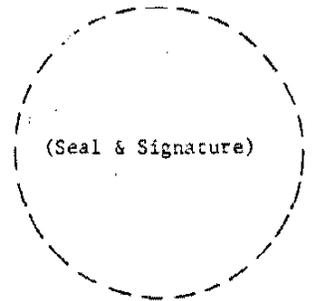

July 24, 1986  
 DATE


7. CORNER DESCRIPTION

N 1/4 CORNER OF SECTION(S) 10, TOWNSHIP 00 N.,  
 RANGE 00 W., Seward MERIDIAN, ALASKA.

SUBDIVISION NAME N/A RECORDER'S PLAT No. \_\_\_\_\_


DATE FILED \_\_\_\_\_

8. RECORDING DISTRICT INFORMATION:

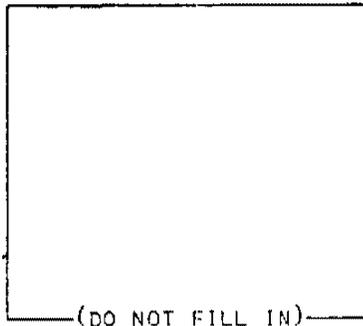

9. LOCATION DIAGRAM

1" : 1 MILE

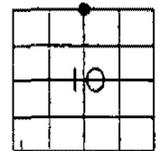

● = LOCATION OF MONUMENT

INDEX REF. No. 15 - V

SAMPLE

STATE OF ALASKA  
DEPARTMENT OF NATURAL RESOURCES

LAND SURVEY MONUMENT RECORD

1.  LAND CORNER RESTORATION  
 LAND CORNER REESTABLISHMENT  
 LAND CORNER ESTABLISHMENT (COMPLETE ITEM NO. 5 )  
 OTHER: EXPLAIN \_\_\_\_\_


2. DESCRIPTION OF CORNER EVIDENCE FOUND OR A CONCISE STATEMENT OF THE METHOD USED TO REESTABLISH THE CORNER:

According to Mr. John Jones, who owns and has lived on the property northeast of the corner for past 12 years, the monument and both original bearing trees were destroyed during construction of George Road. The corner was reestablished at mid-point between the N.E. corner of section 10 and the NW corner of Section 10 was adjusted south to secure the latitudinal curve.


3. DESCRIPTION OF MONUMENT AND ACCESSORIES ESTABLISHED TO PERPETUATE THE LOCATION OF THE MONUMENT.

Set a 2 1/2" brass cap on a 1" x 30" galvanized iron pipe 0.5' below road grade 1' south of north shoulder of George Road. Accessories are blazed and flagged trees as follows:

- 12" Birch, N40°30'E, 41.6'
- 6" Spruce, N11°15'W, 35.7'
- 7" Spruce, S1° W, 56.0'

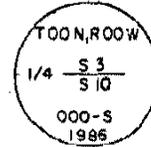

4. SKETCH SHOWING THE RELATIVE LOCATION OF MONUMENT AND REFERENCE POINTS. (USE ADDITIONAL SHEETS IF NECESSARY)

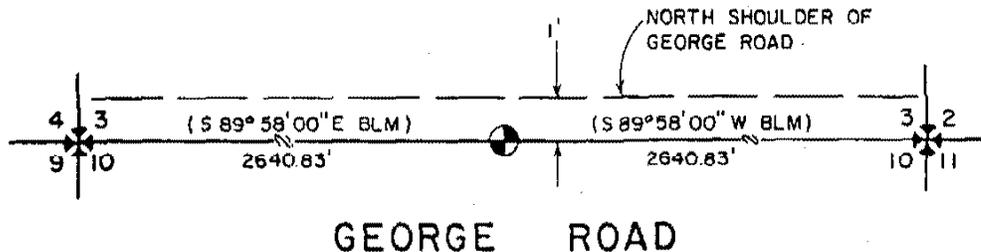

SAMPLE

Appendix 0-1

5. PREPARE A SKETCH SHOWING THE MONUMENTS USED AND MEASUREMENTS MADE TO DETERMINE THE POSITION OF THE MONUMENT BEING ESTABLISHED:

DATE OF FIELD WORK July 17, 1986

SURVEYOR'S CERTIFICATE

6. I John Q. Surveyor,  
 REGISTRATION NO. 0000-S DO HEREBY CERTIFY  
 THAT I WAS IN RESPONSIBLE CHARGE OF THE  
 SURVEYING WORK DESCRIBED IN THIS RECORD AND  
 THAT TO THE BEST OF MY KNOWLEDGE THE INFOR-  
 MATION PRESENTED HEREIN IS TRUE AND CORRECT.



July 24, 1986  
 DATE


7. CORNER DESCRIPTION

N 1/4 CORNER OF SECTION(S) 10, TOWNSHIP 00N,  
 RANGE 00W, Seward MERIDIAN, ALASKA.

SUBDIVISION NAME N/A RECORDER'S PLAT No. \_\_\_\_\_


DATE FILED \_\_\_\_\_

8. RECORDING DISTRICT INFORMATION:

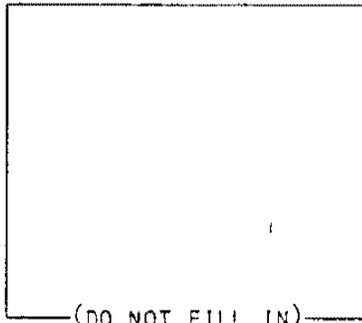

9. LOCATION DIAGRAM

1" : 1 MILE

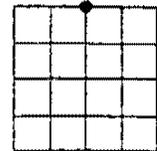

• = LOCATION OF MONUMENT

INDEX REF. No. 15 - 3

SAMPLE

STATE OF ALASKA  
DEPARTMENT OF NATURAL RESOURCES


LAND SURVEY MONUMENT RECORD

- LAND CORNER RESTORATION  
 LAND CORNER REESTABLISHMENT  
 LAND CORNER ESTABLISHMENT (COMPLETE ITEM NO. 5, )  
 OTHER: EXPLAIN \_\_\_\_\_
- DESCRIPTION OF CORNER EVIDENCE FOUND OR A CONCISE STATEMENT OF THE METHOD USED TO REESTABLISH THE CORNER:


- DESCRIPTION OF MONUMENT AND ACCESSORIES ESTABLISHED TO PERPETUATE THE LOCATION OF THE MONUMENT.

Set a 3/4" aluminum cap on a 2" x 30" aluminum pipe 0.2 foot above ground, and an orange Carsonite witness post 1 foot east of monument.

- SKETCH SHOWING THE RELATIVE LOCATION OF MONUMENT AND REFERENCE POINTS. (USE ADDITIONAL SHEETS IF NECESSARY)

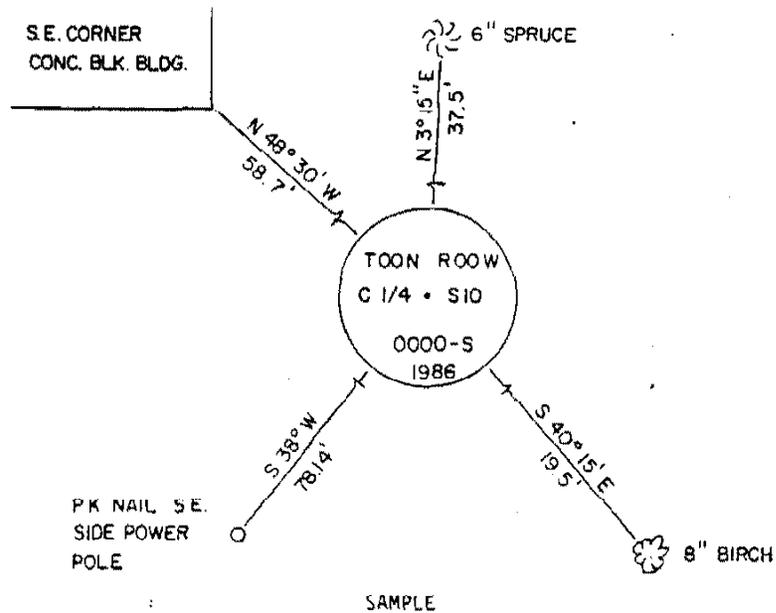


5. PREPARE A SKETCH SHOWING THE MONUMENTS USED AND MEASUREMENTS MADE TO DETERMINE THE POSITION OF THE MONUMENT BEING ESTABLISHED:

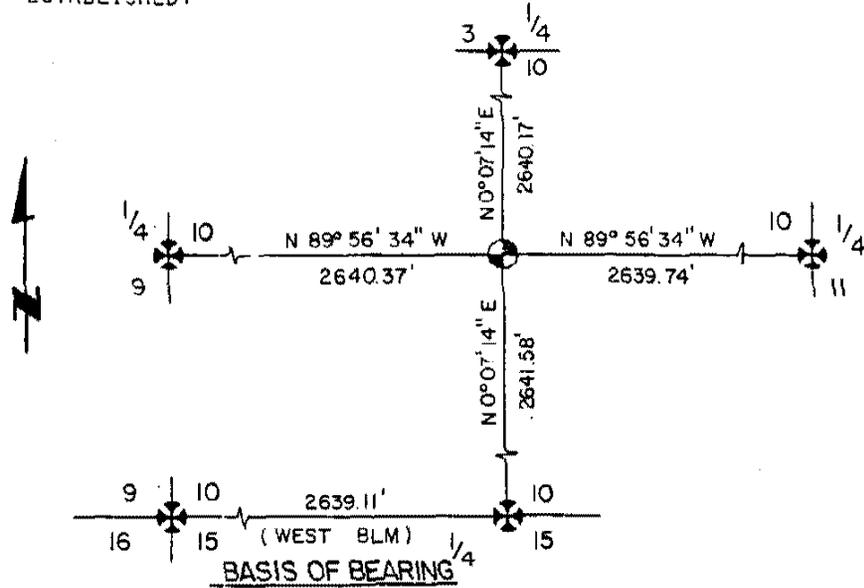

DATE OF FIELD WORK July 17, 1986

SURVEYOR'S CERTIFICATE

6. I John D. Surveyor,  
 REGISTRATION NO. 000-S DO HEREBY CERTIFY  
 THAT I WAS IN RESPONSIBLE CHARGE OF THE  
 SURVEYING WORK DESCRIBED IN THIS RECORD AND  
 THAT TO THE BEST OF MY KNOWLEDGE THE INFOR-  
 MATION PRESENTED HEREIN IS TRUE AND CORRECT.

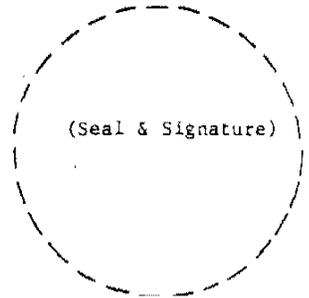

July 24, 1986  
 DATE


7. CORNER DESCRIPTION

C 1/4 CORNER OF SECTION(S) 10, TOWNSHIP 00N.,  
 RANGE 00W, Seward MERIDIAN, ALASKA.

SUBDIVISION NAME N/A RECORDER'S PLAT No. \_\_\_\_\_

DATE FILED \_\_\_\_\_


8. RECORDING DISTRICT INFORMATION:

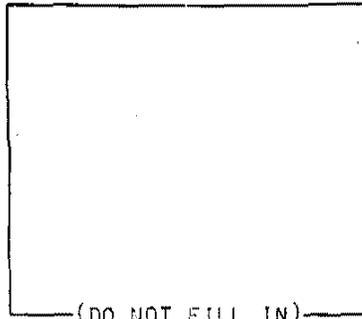

(DO NOT FILL IN)

9. LOCATION DIAGRAM

1" : 1 MILE

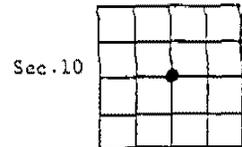

• = LOCATION OF MONUMENT

INDEX REF. No. 15

SAMPLE

STATE OF ALASKA  
DEPARTMENT OF NATURAL RESOURCES

LAND SURVEY MONUMENT RECORD

1.  LAND CORNER RESTORATION  
 LAND CORNER REESTABLISHMENT  
 LAND CORNER ESTABLISHMENT (COMPLETE ITEM NO. 5 )  
 OTHER: EXPLAIN Reference monument prior to removal for construction of George Road.


2. DESCRIPTION OF CORNER EVIDENCE FOUND OR A CONCISE STATEMENT OF THE METHOD USED TO REESTABLISH THE CORNER:

Found a standard U.S. Coast and Geodetic Survey bronze triangulation station disk, stamped: "HILL 1950" welded to a copper pipe 0.9' above ground. Reference marks are 2" x 4" stakes extending 1' above ground with a nail in the center. RM No. 1 bears S 86°21'W, 42.55' and RM No. 2 bears N 56°50' E, 25.10'.

3. DESCRIPTION OF MONUMENT AND ACCESSORIES ESTABLISHED TO PERPETUATE THE LOCATION OF THE MONUMENT.

Set 2" x 2" wood hubs with tacks outside of the proposed clearing limits.

4. SKETCH SHOWING THE RELATIVE LOCATION OF MONUMENT AND REFERENCE POINTS. (USE ADDITIONAL SHEETS IF NECESSARY)

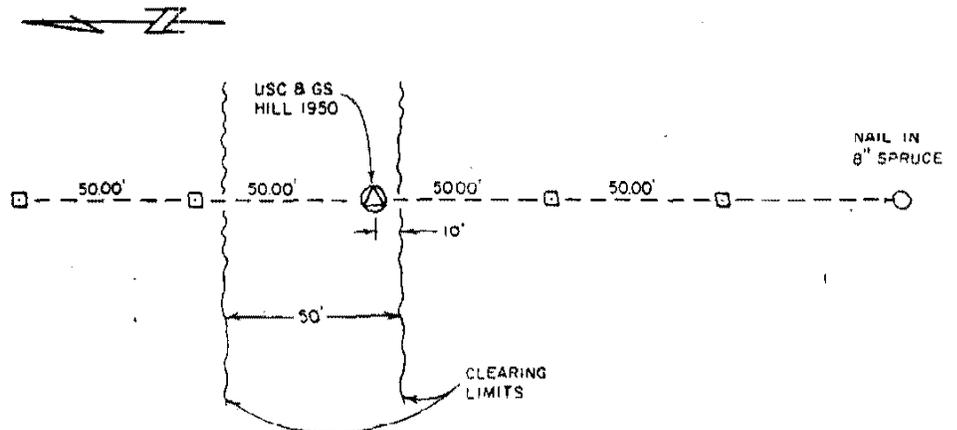

SAMPLE


Appendix F-1

5. PREPARE A SKETCH SHOWING THE MONUMENTS USED AND MEASUREMENTS MADE TO DETERMINE THE POSITION OF THE MONUMENT BEING ESTABLISHED:

DATE OF FIELD WORK July 17, 1986

SURVEYOR'S CERTIFICATE

6. I John Q. Surveyor,  
 REGISTRATION NO. 000-S DO HEREBY CERTIFY  
 THAT I WAS IN RESPONSIBLE CHARGE OF THE  
 SURVEYING WORK DESCRIBED IN THIS RECORD AND  
 THAT TO THE BEST OF MY KNOWLEDGE THE INFOR-  
 MATION PRESENTED HEREIN IS TRUE AND CORRECT.

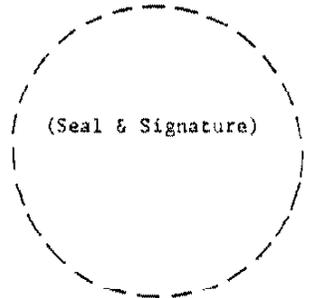

July 24, 1986  
 DATE


7. CORNER DESCRIPTION

"HILL 1950"  
 USC&GS TRI. STA. CORNER OF SECTION(S) 13, TOWNSHIP 00N.,  
 RANGE 00W., Uniat MERIDIAN, ALASKA.


SUBDIVISION NAME \_\_\_\_\_ RECORDER'S PLAT NO. \_\_\_\_\_

DATE FILED \_\_\_\_\_

8. RECORDING DISTRICT INFORMATION:

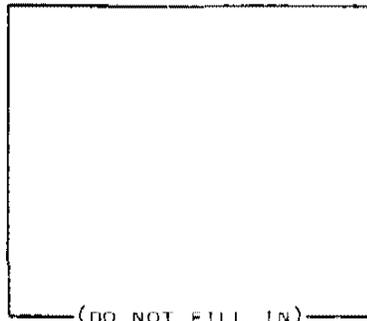

9. LOCATION DIAGRAM

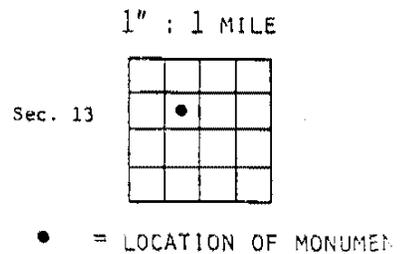

INDEX REF. NO. 23 -

SAMPLE

Appendix F-2